# DuPont Engineering, Inc.

8349 Shady Lady Court Las Vegas, Nevada 89131 (702) 364-5099

### GEOTECHNICAL INVESTIGATION REPORT

Prepared for:

ASSURED REAL ESTATE 160 WEST HORIZON DRIVE, SUITE B HENDERSON, NEVADA 89015

> COMMERCIAL BUILDING 37 SOUTH WATER STREET HENDERSON, NEVADA

> > DEI No.: 18-0379

SEPTEMBER 4, 2018

## DuPont Engineering, Inc.

8349 Shady Lady Court Las Vegas, Nevada 89131 (702) 364-5099

Assured Real Estate 160 West Horizon Ridge Drive, Suite B Henderson, Nevada 89015 September 4, 2018

DEI No.: 18-0379

Subject:

Geotechnical Investigation Report

Commercial Building 37 South Water Street Henderson, Nevada

Sir:

DuPont Engineering, Inc. is pleased to present this geotechnical investigation report for the proposed commercial building. This report discusses the investigation we performed and provides recommendations for items such as grading, foundations, and drainage. We have concluded that the structure may be supported on a shallow foundation system consisting of continuous and spread footings bearing on on-site soils and/or structural fill. Detailed descriptions of our findings, conclusions, and recommendations are contained within the body of this report.

We appreciate the opportunity to work with you on this project and trust that we have provided you with the information you require at this time. If you have any questions, comments, or concerns please give us a call at your convenience.

Respectfully submitted, DuPont Engineering, Inc.

David R. DuPont, P.E. President

DRD

Dist: 3/Addressee

### GEOTECHNICAL INVESTIGATION REPORT COMMERCIAL BUILDING 37 SOUTH WATER STREET HENDERSON, NEVADA

### **Table of Contents**

				Pa	ge
l.	INTRO A. B.	PDUCTION	 		. 1
II.	FIELD A. B. C.	INVESTIGATION. Site Description. Drilling and Sampling Methods. Subsurface Conditions.	 		. 1 . 1
III.	GEOLO A. B. C.	OGY AND SEISMICITY	  		. 2 . 3
IV.	LABOF	RATORY TESTING	 		. 6
V.	CONC	LUSIONS	 		. 6
VI.	RECO A. B. C. D. E. F.	MMENDATIONS Grading Excavation Difficulties Foundations Slabs Concrete Durability Site Drainage Landscaping	 		. 6 . 8 . 9 . 9
VII.	LIMITA	ATIONS AND CLOSURE	 		11
APPE	XIDIX				
A. B. C. D. E. F. G. H.	Atterbe Silver S Earth F	an			

DEI No.: 18-0379 September 4, 2018

### I. INTRODUCTION

This report describes the results of DuPont Engineering, Inc.'s geotechnical investigation for the proposed commercial building.

### A. Purpose and Scope of Services

The purpose of this investigation was to:

- 1. Determine the subsurface soil conditions at the site.
- 2. Provide geotechnical recommendations for the commercial building pertaining to:
  - i. Grading
  - ii. Excavation Difficulties
  - iii. Foundations
  - iv. Slabs
  - v. Concrete Durability
  - vi. Site Drainage
  - vii. Landscaping

### B. Project Description

The proposed development consists of a commercial building to be located on an approximate 0.44 acre lot at 37 South Water Street in Henderson, Nevada. The APN for the site is 179-18-611-056. The structure will be one-story in height of wood-frame construction and have a slab-on-grade concrete floor. Design loads have not been provided to us; therefore, we have assumed loads typical for this type of construction. The site location is shown on the Vicinity Map and a Site Plan has been provided which illustrates the lot layout.

### II. FIELD INVESTIGATION

### A. Site Description

At the time of our exploration the site was part of a commercial development that was paved with asphalt. The site was generally flat with a slight drainage to the north at a gradient of about 2 percent. Drainage was by sheet flow. The average elevation of the site was about 1 to 2 feet below Water Street, a paved road. Minor amounts of trash and debris were noted.

### B. Drilling and Sampling Methods

A subsurface exploration of the site was conducted by drilling two 15-foot deep borings at the approximate locations shown on the Site Plan. The borings were made using a truck-mounted drill

DEI No.: 18-0379 September 4, 2018

rig. The drill rig uses air-rotary drilling techniques that send soil particles to the surface by pressure created from compressed air allowing for instant soil identification. Due to the granular nature of the subsurface soils, drive samples were not obtained. The soils were classified per the ASTM D 2487 Test Procedure. Pertinent engineering properties were determined from drilling characteristics, visual examination, and our geotechnical experience. A disturbed bulk sample was obtained for chemical testing to determine the concrete durability requirements.

### C. Subsurface Conditions

The soils encountered at the site consisted of gravelly sand that was loose to medium dense in the upper 8 to 10 feet, then dense to 15 feet. Groundwater was not encountered within the borings at the time of our exploration.

### III. GEOLOGY AND SEISMICITY

### A. Regional Geology

The Las Vegas Valley lies within the southern portion of the Walker Lane Belt of the Basin and Range Province. The Basin and Range Province extends from southern Idaho to northern Mexico and is an area of tilted northwest trending mountain ranges divided by sediment filled valleys.

The Las Vegas Valley is bounded by several of these mountain ranges. To the west are the Spring Mountains which have an elevation up to 12,000 feet at Charleston Peak. The northern portion of the Spring Mountains were deposited in deep ocean environments and are predominantly limestone and dolomite deposits of the Ordovician through Mississippian. Jurassic Sandstone deposits occur along the eastern flank of this range.

To the north of the valley lie the Las Vegas and Sheep Mountain Ranges. These ranges consist mostly of deep ocean limestone deposits from the Ordovician through Mississippian. The Las Vegas Range reaches an elevation of about 7000 feet, while the Sheep Range extends up to 10,000 feet.

Frenchman and Sunrise Mountains are located to the east of the valley and reach heights of about 4500 and 3500 feet, respectively. The exposed bedrock at the base of Frenchman Mountain is Precambrian schist which lies below Tapeats Sandstone, Bright Angel Shale, and Muav Limestone. The contact between the sandstone and the schist represents the great unconformity where an age gap between the rocks of 1.7 billion years exists. The upper portion of Frenchman Mountain has Jurassic sandstone and Tertiary volcanic outcrops exposed. The exposed sedimentary materials along the face of these two mountains match the exposures in the Grand Canyon. It is theorized that faulting during the last 13 million years has moved Frenchman Mountain from its original position in the Grand Canyon/Virgin Mountains to its present position.

DEI No.: 18-0379 September 4, 2018

To the south and southeast of the valley lie the River Mountains and the McCullough Mountain Range. The McCullough Range is the higher of the two and reaches an elevation of about 5000 feet. These mountains predominantly consist of Tertiary volcanics (mostly andesite and basalt) of the Miocene. These ranges are the remnants of the western and northern flanks of two large strato volcanoes that have mostly eroded away. The Black Hills located to the east of the McCullough Range are the remains of the central portion of one of the volcanoes.

The Las Vegas Valley itself is filled with sediment from the adjacent mountains and mountain ranges. Near the bases of the mountains where gradients are steeper the soils are typically granular. Finer grained sediments dominate the center and flatter portion of the valley. The current arid climate of Las Vegas produces an average rainfall of less than 3 inches per year, hence erosion and deposition rates are minimal at this time.

Overall drainage in the valley is toward the east and southeast via numerous large washes. The trunk wash where these washes converge is known as the Las Vegas Wash, normally an ephemeral stream that, due to development, carries water year round.

### B. Regional Seismicity

During the Mesozoic the once passive west coast of the North American continent began to undergo compression as the East Pacific Rise pushed the Farallon Plate into and under the North American Plate. This process created regional uplift leading to the formation of mountains along the west coast including the Spring Mountains and the Las Vegas Range. The compressional forces led to thrust faulting which occurred locally in both of these mountain ranges. Some of the most notable thrust faults in these mountains include the Keystone, Lee Canyon, Kyle Canyon, Deer Creek, Wheeler Pass, and Mack Canyon Thrusts.

During the mid-Oligocene, about 30 million years ago, the Farallon Plate had completely subducted and the North American Plate began to pass over the East Pacific Rise. Extensional forces now began pulling apart the western portion of the North American Plate. Dip-slip faulting resulted and began breaking apart and tilting the mountain ranges forming the basins and ranges of the Basin and Range Province. The melting of the Farallon Plate as it subducted renewed volcanic activity along the west coast forming, among others, the Sierra Nevada Batholith, the River Mountains, Black Hills, and the McCullough Range.

Seismic activity in the Las Vegas Valley continued from this time until about 8 million years ago. Most faults in the vicinity of the valley during this time were dip-slip faults; however, a few major strike-slip faults were present. Most notably was the left lateral fault known as the Las Vegas Shear Zone located in the northern portion of the valley. Offset along this fault is more than 40 miles and is responsible for the bends in the southern portion of the Las Vegas and Sheep Ranges. It is likely responsible for much of the movement of Frenchman Mountain.

DEI No.: 18-0379 September 4, 2018

Between about 8 million and 4 million years ago, during the late Miocene, seismic and volcanic activity in the Las Vegas area was minimal. Seismic activity, however, resumed about 4 million years ago and continues to the present day. Many Quaternary faults have been mapped throughout the Valley. These faults step downward from the surrounding mountains toward the center of the valley and were originally thought to be caused by differential settlement of the subsurface soils. They were given the name compaction faults by Maxey and Jameson in 1948. Although this terminology exists to this day, more recent research indicates that these faults are actually tectonic and that differential settlement plays only a small contributing factor. None of these faults within the interior of the valley has been shown to be active within the Holocene. One of these faults, however, the Valley View Fault, did experience movement as little as 14,000 years ago. There are at least four known Holocene faults within the perimeter of the valley. These are the Frenchman Mountain Fault located at the base of Frenchman Mountain, the Black Hills Fault located at the eastern flank of the Black Hills, the California Wash Fault which lies along the western flank of the Muddy Mountains, and the Mead Slope Fault northeast of Boulder City. Each of these faults is capable of Richter magnitude of 6.5 to 7.0. Although no known movement has occurred on these faults within the past 2000 years, it is believed that they are long overdue for producing large earthquakes.

The nearest known Holocene fault is the Black Hills fault and is located approximately 3 miles east of the site. The nearest mapped Quaternary fault is located approximately 2 miles to the southwest of the site. The Quaternary fault locations were originally mapped by Bell and Price in the 1980's. Their study was published in 1993 and was subsequently used by the Clark County Building Department to create the "Clark County Soil Guidelines Map" in 1997. The Soil Guidelines Map is the reference used for determining the distance to the nearest Quaternary fault. Liquefaction should not be a concernat this site. For liquefaction to occur it is necessary for loose saturated granular soils to be present. This soil condition is not known to exist in the near surface soils.

The latitude and longitude of the site are 36.0352 and -114.9852, respectively. The Clark County Seismic Map indicates that the Site Classifies as Site Class C. Based Upon our knowledge of the soils in the vicinity of the site, we concur with the County map. The Seismic Design Category (International Building Code, 2012) is C based on the following data:

SITE CLASS	ASSUMED SEISMIC USE GROUP	Ss	S <sub>1</sub>	S <sub>DS</sub>	S <sub>DI</sub>	SEISMIC DESIGN CATEGORY
С	II	0.493	0.162	0.395	0.177	С

There are no known geologic features that would require mitigation at this site. No faults are known to traverse the site, nor are any fissures observed.

DEI No.: 18-0379 September 4, 2018

### C. Clark County Soil Guidelines Maps

The Clark County Building Department created two maps which illustrate potential soils hazard areas within the Las Vegas Valley. The intent of the maps is to provide guidance to engineers performing investigations within any of these areas.

The Clark County Soil Guidelines Map (August 2001) delineates four types of potential soil hazards and a non-hazard type generally consisting of mixed alluvial sand and gravel. The four hazard types are:

- (I) Areas within 2000 feet of compaction or tectonic faults. These areas include 90 percent of all mapped fissure zones. Soil subsidence is the general hazard associated with this type of soil. These phenomena are discussed in the previous report section, Regional Seismicity.
- (ii) Areas within 1000 feet of mapped washes. Aside from evaluating possible erosional damage to the property, the general hazards associated with these areas include recent sediment deposits and soils with a potential for solubility, clay swell, corrosion, gypsum salts, or hydro collapse.
- (iii) Areas with the same potential hazards as described in Paragraph (ii) except for the recent sediment deposits and possible erosional damage.
- (iv) Areas with ground slopes in excess of 15 percent and the potential for shallow bedrock.

Per the Clark County Soil Guidelines Map the subject site is located in the non-hazard area.

The Clark County Expansive Soil Guidelines Map (September 2006) delineates potential expansive soil areas. According to the map, the map is intended to show general trends of near surface soils in the Las Vegas Valley. The soil conditions for a specific site could vary considerably from those described on the map. The areas are defined on the map as follows:

- (I) Areas with greater than 12 percent expansion potential which is considered critical.
- (ii) Areas with 8 to 12 percent expansion potential which is considered high.
- (iii) Areas with 4 to 8 percent expansion potential which is considered moderate.
- (iv) Areas with 0 to 4 percent expansion potential which is considered none to low.

Per the map the subject site is located within an area described as having expansion potentials considered moderate.

DEI No.: 18-0379 September 4, 2018

When developing the recommendations for this report, we reviewed both maps and utilized the information they contain in conjunction with our field and laboratory testing data as well as our experience in the vicinity.

### IV. LABORATORY TESTING

Representative samples were tested in the laboratory to obtain pertinent engineering properties for our analyses.

Laboratory testing on selected samples included, Atterberg Limits (ASTM D4318) and gradation (ASTM D1140). The results of these tests are included on the boring logs and in the Appendix.

Chemical tests made by Silver State Analytical Laboratories to determine concrete durability requirements had the following results. The testing by Silver State included soluble sulfate content (SM 4500 S04 E), and sodium content (ASTM D2791). The results of Silver State's testing is contained in the Appendix.

### V. CONCLUSIONS

Based upon our investigation, it is our opinion that, with regard to geotechnical considerations, construction of the proposed project is feasible at the site.

### VI. RECOMMENDATIONS

### A. Grading

For the purposes of this report the building pad area is considered to encompass the footprint of the structure plus a distance of 5 feet laterally beyond the structure in each direction. Prior to grading operations being performed, all vegetation, debris, loose soils, and uncontrolled fill (if any) should be removed from the pad area. Based upon the boring logs the depths of removals could be 2 to 3 feet due to soils that appear to be loose.

Prior to any filling and after the necessary excavations are made, the soils within the pad area are to be scarified to a depth of 12 inches, moisture conditioned, then recompacted. Next, any removed and stockpiled excavated soils should be moisture conditioned then recompacted in the excavation. Oversized material (particles larger than 6 inches in maximum diameter) should be removed from any stockpiled soils prior to fill placement.

The thickness of any lift of soil should not exceed 8 inches in loose thickness. All fill and scarified soil should be moisture conditioned and compacted in accordance with the specifications of Table

DEI No.: 18-0379 September 4, 2018

1. ASTM Test Method D 1557 should be used for determining the laboratory maximum dry density.

### TABLE 1

Soil Type Coarse-grained Moisture Content
Over optimum

Relative Compaction
Minimum 95 percent

If imported soils are necessary to reach the site grade, they should comply with the following specifications contained in Table 2. If possible, the imported materials should be tested for compliance prior to hauling the material to the site.

### TABLE 2

Sieve Screen	Percent Passing (%)
3 inch	100
¾ inch	50 - 100
No. 4	25 - 75
No. 200	5 - 25
	!
Liquid Limit < 20	Soluble Sulfate < 0.10%
Plasticity Index < 6	Sodium Sulfate < 0.10%
Expansion Potential < 2%	Total Solubility < 0.5 %
(oven-dried, 60 psf surcha	irge)

We anticipate that excavation and recompaction of the on-site soils will result in shrinkage losses on the order of 10 percent. Therefore, it should require about 1.1 cubic feet of fill for each one foot of fill removed. Subsidence of the native soils which are scarified and recompacted will also be about 0.1 inch.

The scarification and filling operations should be monitored and density testing performed by a representative of the geotechnical engineer in order to ensure compliance with the recommendations of this report. The frequency of the testing shall be determined by the engineer performing the testing. However, as a minimum one density test should be performed for each one foot of fill in the pad area. Based on the composition of the on-site soils, the site is considered to be Special Inspection Category G-A. Therefore, periodic inspection of grading operations is acceptable.

DEI No.: 18-0379 September 4, 2018

### B. Excavation Difficulties

The soils encountered at the site may be excavated with conventional earth-moving equipment. No special equipment such as a hoe-ram or large bulldozer is anticipated to be necessary.

### C. Foundations

The proposed structure may be supported on shallow conventional foundations consisting of continuous and spread footings. All footings should bear upon on-site soils and/or compacted fill. Prior to concrete placement all footings should be cleaned of loose soils and any trash or debris. If the soils at the bottom of the footing excavations should become disturbed, they should be recompacted in accordance with the recommendations of the Grading section of this report.

Continuous footings should have a minimum width of 12 inches. Spread footings should be a minimum of 2 feet square. The exterior footings should be embedded a minimum of 12 inches below the lowest compacted grade. Interior footings should be embedded a minimum of 12 inches below the top of the slab. An allowable bearing pressure of 1800 psf may be used for both continuous and spread footings. A one-third increase may be used for either wind or seismic loading. As a minimum, two No. 5 bars should be placed at the tops of the footings and two No. 5 bars at the bottoms of the footings.

Lateral loading on the structure may be resisted by both friction acting on the base of the foundations as well as passive earth pressure acting along the sides of the foundations. When determining the frictional component of the lateral resistance a coefficient of friction of 0.35 may be used. For the passive pressure component, the resisting pressure may be determined by considering the compacted soil as an equivalent fluid weighing 350 pcf. Passive resistance should not be considered for the upper 4 inches of soil. Furthermore, if any backfilling will be performed against foundations where the passive pressure resistance will be utilized, the backfilling should be monitored and tested by a representative of the geotechnical engineer. If an active pressure will be considered, an equivalent fluid weighing 38 pcf should be used.

Anticipated total settlement of the foundations and slab would be less than 1 inch. Differential settlement is anticipated to be half the magnitude of the total settlement.

If retaining walls will be present on the project, the recommendations given above regarding subgrade preparation, allowable bearing capacity, the coefficient of friction, and the passive pressure may be used in conjunction with an active pressure equivalent to that produced by a 38-pcf fluid. These design parameters assume that water will not collect behind the retaining walls. Suitable drains or weep holes should be provided to eliminate this possibility. If the tops of the walls are restrained, then an at-rest pressure equivalent to a 60-pcf fluid should be used instead of the active pressure.

DEI No.: 18-0379 September 4, 2018

Under seismic conditions, the active and at-rest equivalent fluid unit weight should be increased to 54 and 120 pcf, respectively. The resultant of the seismic component of earth pressure (i.e., the difference between seismic and static conditions) should be applied at 0.6 of the height where lateral soil pressure is acting. If seismic lateral pressure distribution is needed, it may be taken as an inverted trapezoid (see attached Earth Pressure Distribution Figure).

If the backfill behind the wall is not horizontal or if surcharge loads exist, these earth pressure design parameters should be reviewed.

### D. Slabs

Concrete floor slabs should be supported on a layer of granular material that consists of a combination of Type II Aggregate Base, a visqueen membrane, and sand. The layer acts as a buffer between larger particles in the subgrade and the concrete, a moisture break, and assists the curing of the concrete. After constructing and compacting the pad to subgrade elevation, 4 inches of Type II should be placed. The Type II should be compacted above the optimum moisture content to a minimum of 95 percent of the maximum dry density (ASTM D 1557). The Type II should be overlain by a 10-mil visqueen membrane, then 2 inches of clean sand.

If steel reinforcement will be placed within the slab, it should be placed at mid-height of the slab unless otherwise specified by the structural engineer. Concrete should be placed and cured within the guidelines established by the American Concrete Institute Guide for Floor and Slab Construction, ACI 302.1, latest edition. Since all concrete shrinks upon curing, control joints should be grooved into the concrete at the time of placement, or saw-cut shortly thereafter, in order to control the locations of any shrinkage cracks that might develop.

### E. Concrete Durability

Concrete durability is affected by soluble sulfates that are sometimes present in the soil. High concentrations of these sulfates can cause spalling and deterioration of the concrete. A sample of the on-site soils was tested by Silver State Analytical Laboratories, Inc. for soluble sulfate content. Based upon the results of the test, the concentration of soluble sulfates at the site may be considered negligible (S0) for the purpose of concrete design. All concrete that will be in contact with on-site or imported soils should be in accordance with the following table which is adapted from ACI-318.

SEVERITY	EXPOSURE CLASS	WATER- SOLUBLE SULFATE (SO <sub>4</sub> ) IN SOIL, percentage by weight	SULFATE (SO <sub>4</sub> ) IN WATER, ppm	CEMENT TYPE ASTM C150	CaCl <sub>2</sub> ADMIX	MAXIMUM WATER TO CEMENT RATIO	MINIMUM f' o NORMAL WEIGHT AND LIGHTWEIGHT AGGREGATE CONCRETE, psi
Negligible	S0	0.00 - 0.10	0 - 150	NR	NR	NA	2500
Moderate	S1	0.10 - 0.20	150 - 1500	11	NR	0.50	4000
Severe	S2	0.20 - 2.00	1500 - 10000	V	NP	0.45	4500
Very severe	S3	Over 2.00	Over 10000	V+ Pozz. or Slag	NP	0.45	4500

NA = Not Applicable

NR = No Restriction

NP= Not Permitted

### F. Site Drainage

Most soil related problems that can lead to structural distress are caused by moisture variations within the soils below the structure. Typically, it is an increase in the moisture content that creates problems. Therefore, the most important thing that one can do to prevent problems is to inhibit additional moisture from entering the soils below the structure. If this occurs, the soils below the building pad may experience volume changes resulting in structural distress due to excessive soil movement.

Positive site drainage should always be established away from the foundations and exterior of any structure. A minimum downward gradient of 5 percent should be maintained away from the structure for a distance of at least 10 feet, if possible.

Planter areas between the flatwork and a structure should not trap water. Care should be taken to not allow roof drainage to spill onto the ground adjacent to the foundations. If necessary, rain gutters should be utilized.

The utility trenches within a structure should be backfilled and compacted above the optimum moisture content to a minimum of 90 percent of the maximum dry density (ASTM D 1557) with the on-site soils or approved imported soils. The compaction of the utility lines should include where the utilities exit or approach the structure for a minimum distance of 5 feet beyond the limit of the structure. Care should be taken to prevent damage to the utility lines during the compaction process.

DEI No.: 18-0379 September 4, 2018

### G. Landscaping

As mentioned in the previous section, increases in the moisture content of the subsurface soils below the structure are typically the root cause of structural distress. Therefore, landscaping restrictions are warranted.

All trees should be placed at least 10 feet from the exterior of each structure and its foundations. No other landscaping or irrigation lines should be placed within 5 feet of a structure.

Some landscaping rocks imported to the area contain high concentrations of soluble sulfates. These rocks can sometimes break down due to chemical weathering and release the sulfates into the soil where either none or only low concentrations had been present before. In order to reduce risk to the concrete, we recommend that landscaping rock be placed at least 5 feet from any structure or any concrete flatwork. If it is desired to place the rock closer to any concrete, the rock should first be tested for soluble sulfate concentrations.

### VII. LIMITATIONS AND CLOSURE

The opinions and recommendations contained in this report were based upon the soil conditions observed at the site and our engineering experience in the area. Although the exploration borings provided us with a subsurface profile, it is possible that the soil conditions across the site vary from those described in the boring logs. Should the subsurface conditions be found to vary from those described, our office should be consulted to evaluate the present recommendations and make any necessary modifications.

All recommendations in this report are valid predicated upon verification by a representative of the geotechnical engineer, at the time of construction, that the recommendations have been complied with. Therefore, it is the responsibility of the addressee and/or developer to ensure that all parties involved in the project, that these recommendations may affect, be provided or made aware of this report, so that they may properly satisfy the recommendations contained within.

The developer or owner must understand that because the structure rests upon the ground, there are inherent risks to property due to earth movement. Although we provide recommendations to minimize risk, there are no guarantees that some structural distress could not occur in the future. Therefore, no warranties, either express or implied, are intended or made. We recommend that this report become a mandatory part of the escrow documents for the site so that the future owners of the property will be aware of the report's contents and may take the appropriate steps to follow or maintain its recommendations.

DEI No.: 18-0379 September 4, 2018

Assured Real Estate Commercial Building 37 South Water Street DEI No.: 18-0379 September 4, 2018


Our professional services have been performed using the degree of care and skill ordinarily exercised, under similar circumstances, by reputable geotechnical engineers practicing in this or similar localities. If you have any questions, concerns, or comments regarding the contents of this report, please give us a call.

Respectfully submitted, DuPont Engineering, Inc.


David R. DuPont, P.E. President

DRD

# Appendix

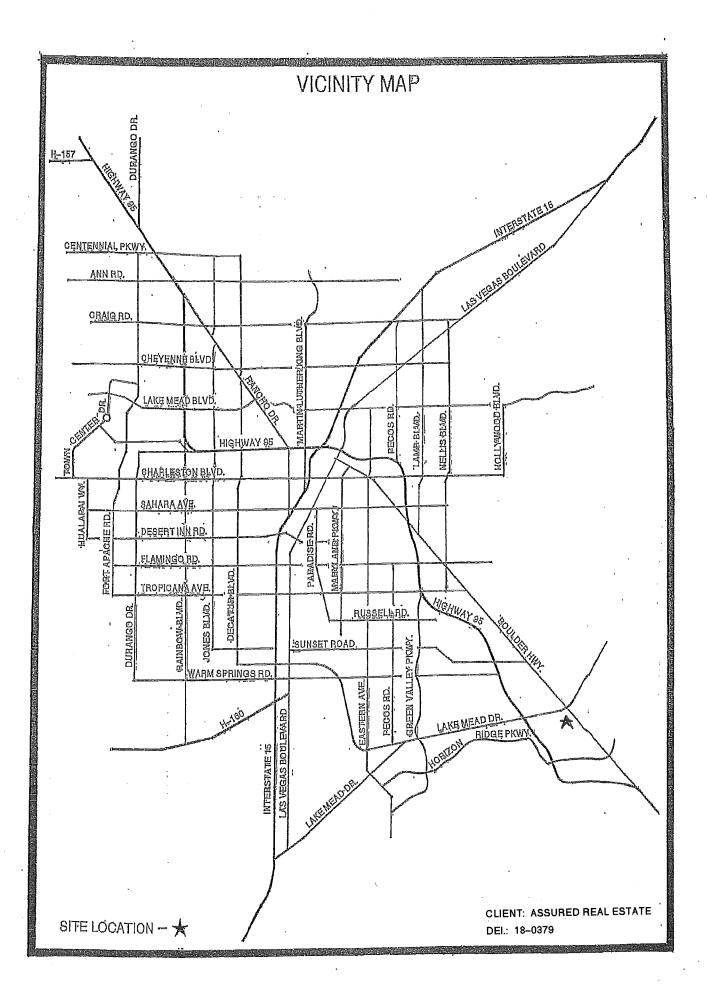

### SITE PLAN ASSURED REAL ESTATE 37 SOUTH WATER STREET HENDERSON, NEVADA

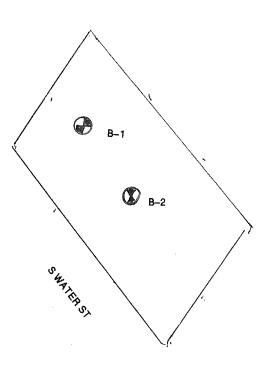

CLIENT: ASSURED REAL ESTATE

DEI NO.: 18-0379

Client:

Assured Real Estate

Project:

Commercial Building

Boring #

**Location:** 37 South Water Street

Henderson, Nevada

DEI No.:	18-0379	Date Drilled:	8/29/2018
.ogged By:	D. DuPont	Datum:	Ground Surface
Boring Type:	6" Rotary Air	Type Rig:	Mayhew

Moisture Content, % Resistance, blows/6 inches Dry Density, pcf Unified Soil
O Classification се Cohesion, ksf Sample type В Depth, feet Latitude: 36.0352 Longitude: -114.9852 **Groundwater Conditions:** None ATE SOIL DESCRIPTION **ASPHALT OVER TYPE 2** SW-SM GRAVELLY SAND - brown, loose to medium dense, slightly moist 2--В 4--В 8--10-dense 12-14-BOE 16-18Client:

Assured Real Estate

Project:

Commercial Building

Boring # B-2

**Location:** 37 South Water Street


Henderson, Nevada

DEI No.:	18-0379	Date Drilled:	8/29/2018
Logged By:	D. DuPont	Datum:	<b>Ground Surface</b>
Boring Type:	6" Rotary Air	Type Rig:	Mayhew
Latitude:	36 0351	Longitude	-114 9851

Depth, feet	Sample type	Resistance, blows/6 inches	Cohesion, ksf	Moisture Content, %	Dry Density, pcf	Unified Soil Classification	DEI No.: Logged By: Boring Type: Latitude: Groundwater C	SOIL DE	Date Drilled: Datum: Type Rig: Longitude: None ATE SCRIPTION	8/29/2018 Ground Surface Mayhew -114.9851
2						AC SW-SM	ASPHALT GRAVELL' slightly moi	OVER TYPE 2 Y SAND - brown ist	, loose to med	lium dense,
4										· · · · · · · · · · · · · · · · · · ·
6										
8		1000					dense			
10		70 AV-4				and the second s				·
12						·	_		·	
16	-				The second section of the sect				BOE	
18							_			
		40								

### GRADATION ANALYSIS COMMERCIAL BUILDING 37 SOUTH WATER STREET HENDERSON, NEVADA

### SIEVE CHART

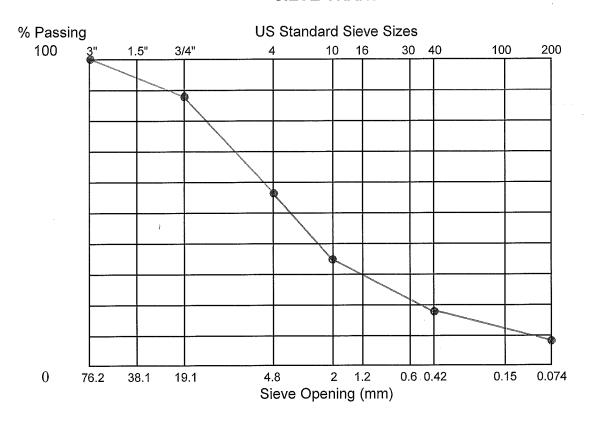

Sieve Size	% Passing	$D_{60} = NA$
3-inch	100	$D_{30} = NA$
3/4-inch	88	$D_{10} = NA$
No. 4	57	
No. 10	35	$C_u = NA$
No. 40	18	$C_c = NA$
No. 200	7.8	


Atterberg Limits	Soil Classification by USCS
LL = NA	Silty Sand (SM) with gravel
PL = NA	
PI = NP	Boring B-1 @ 5 feet

CLIENT: ASSURED REAL ESTATE DEI NO.: 18-0379

### ATTERBERG LIMITS COMMERCIAL BUILDING 37 SOUTH WATER STREET HENDERSON, NEVADA

### ATTERBERG LIMITS CHART



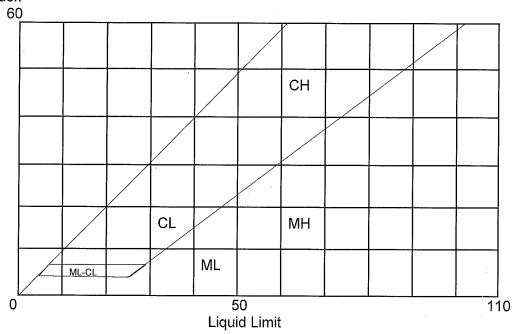

### **TEST RESULTS**

Boring No.	Depth	Symbol	Liquid Limit	Plastic Limit	Plasticity Index	Classification
1	5		_	-	NP	Silt

Note: The Atterberg Limits test is performed on soils passing the #40 sieve screen. Therefore, the classification indicated in the table above represents the behavior of the soils passing the #40 screen only.

CLIENT: ASSURED REAL ESTATE

DEI NO.: 18-0379



Silver State Labs-Las Vegas

**Analytical Report** 

WO#:

18081621

Date Reported:

9/4/2018

**CLIENT:** 

**DuPont Engineering** 

**Collection Date:** 

Project:

Water

Lab ID:

18081621-01

Matrix:

SOIL

Client Sample ID Water

Analyses	Result	RL Qual	Units	DF	Date Analyzed
SOIL 1. WSSS-WATER SOL. SODIUM SODIUM SULFATES - CALCULATION			CALCU	LATION	Analyst: <b>SBK</b>
Sodium Sulfate as Na2SO4	ND	0	%	1	9/4/2018 3:10:00 PM
SOIL 1. WSSS-WATER SOL. SODIUM WATER SOLUBLE SULFATE (SO4)	/I SULFATE.		SM 450	0 SO4 E	Analyst: SBK
Sulfate	ND	0.0100	%	1	9/4/2018 1:43:25 PM
SOIL 1. WSSS-WATER SOL. SODIUM WATER SOLUBLE SODIUM (NA)	/I SULFATE.		ASTM	D2791	Analyst: SBK
Sodium	ND	0.0100	%	1	9/4/2018 1:45:00 PM

Value exceeds Maximum Contaminant Level.


Dilution Factor. DF

C Value is below Minimum Compound Limit.

Holding times for preparation or analysis exceeded. Η

ND Not Detected at the PQL.

# Earth Pressure Distribution

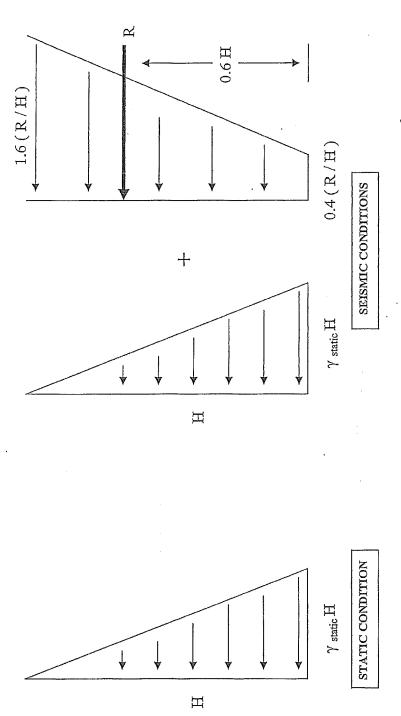

 $R = Resultant \ of \ seismic \ component \ of \ earth \ pressure \ per \ unit \ length \ of the \ wall = \% \ (\gamma \ _{seismic} - \gamma \ _{static}) \ H^2.$ 

 $H=Height\ of\ the\ wall$   $\gamma=Height\ of\ the\ value for\ active\ or\ at\ rest\ conditions,\ as\ applicable.$  Note: Surcharge pressure is not included here and should be added, if applicable.

### KEY TO SYMBOLS AND TERMS USED ON BORING AND TEST PIT LOGS

# METHOD OF SOIL CLASSIFICATION (ASTM D 2487)

### COARSE-GRAINED SOILS LESS THAN 50% FINES

### FINE-GRAINED SOILS MORE THAN 50% FINES

GROUP	DESCRIPTION	MAJOR
SYMBOLS		DIVISIONS
GW	WELL-GRADED GRAVELS OR GRAVEL-SAND MIXTURES,	
	LESS THAN 5% FINES	GRAVELS
GP <sub>.</sub>	POORLY-GRADED GRAVELS OR GRAVEL-SAND MIXTURES, LESS THAN 5% FINES	More than half of coarse fraction
GM	SILTY GRAVELS, GRAVEL- SAND-SILT MIXTURES, MORE THAN 12% FINES	is larger than No. 4 sleve size
GC	CLAYEY GRAVELS, GRAVEL- SAND-CLAY MIXTURES, MORE THAN 12% FINES	
SW	WELL-GRADED SANDS OR GRAVELLY SANDS, LESS THAN 5% FINES	SANDS
SP	POORLY-GRADED SANDS OR GRAVELLY SANDS, LESS THAN 5% FINES	One half or more of coarse
SM	SILTY SANDS, SAND-SILT MIXTURES, MORE THAN 12% FINES	fraction is smaller than No. 4
SC	CLAYEY SANDS, SAND-CLAY MIXTURES, MORE THAN 12% FINES	sieve size

GROUP	DESCRIPTION	MAJOR
SYMBOLS		DIVISIONS
ML	INORGANIC SILTS, VERY FINE	
	SANDS, ROCK FLOUR, SILTY OR	
	CLAYEY FINE SANDS	SILTS
CL	INORGANIC CLAYS OF LOW TO	AND
0.1	MEDIUM PLASTICITY, GRAVELLY	CLAYS
	CLAYS, SANDY CLAYS, SILTY	Liquid
	CLAYS, LEAN CLAYS	limit
OL	ORGANIC SILTS OR ORGANIC	less
	SILTY-CLAYS OF LOW	than 50
	PLASTICITY	
MH	INORGANIC SILTS, MICACEOUS	
•	OR DIATOMACEOUS FINE SANDS	SILTS
	OR SILTS, ELASTIC SILTS	AND
CH	INORGANIC CLAYS OF HIGH	CLAYS
_,,	PLASTICITY, FAT CLAYS	Liquid
		limit
ОН	ORGANIC CLAYS OF MEDIUM TO	50 or
1	HIGH PLASTICITY	more
PT	PEAT, MUCK, AND OTHER	HIGHLY
	HIGHLY ORGANIC SOILS	ORGANIC
1		SOILS

Notes: Only sizes smaller than 3 inches are used to classify soils.

Dual classification used for borderline soil groups.

### LOG ABBREVIATIONS

Miscellaneous:

ATE - at time of exploration AE - after exploration

BOE - bottom of exploration ∇ 0 - Groundwater level at time

of exploration

∇ 72 - Groundwater level 72 hours after exploration

Sample Type:

R - ring sample

S - Standard Penetration Test

D - disturbed sample

C - core sample

U - undisturbed sample

B - bulk sample

H - hand drive ring sample

NR - no recovery

REF - sampler refusal

Note: Ring sampler is a split-barrel sampler with 1" rings. Inside diameter is 2½" and outside diameter is about 3.1". Blow counts shown represent the number of blows for 6" penetration for a 320-pound hammer falling freely through a 30" vertical distance. Energy ratio correlations indicate a close correspondence with Standard Penetration Test values with a 140-pound hammer falling 30" with a standard split spoon sampler.